

<ul style="list-style-type: none"> • CONVERTIBLE TOP—“RATTLES” AND “SQUEAKS” FROM B-PILLAR • NOISE—“RATTLES” AND “SQUEAKS” FROM B-PILLAR 	Article No. 90-24-5
--	--------------------------------

MERCURY: 1991 CAPRI

ISSUE

“Rattles” and “squeaks” may come from the “B” pillar at the convertible top side tension wire attaching points. This is caused by movement of the 'Z' link inside the pivot retainer.

ACTION

Apply silicone rubber over the side tension wire 'Z' link to stop it from moving inside the pivot retainer. Refer to the following procedure for service details.

1. Unhook the convertible top from the rear retainer and fold the rear section forward, Figure 1.
2. Fold back the convertible top side fabric to access the side tension wire 'Z' link and pivot retainer.
3. Apply black silicone rubber over the 'Z' link, Figure 1. Repeat this operation for the opposite side of the convertible top.

4. Attach the convertible top to the rear retainer.
5. Latch the convertible top, allowing the silicone rubber to cure with the side tension wires tight.

PART NUMBER	PART NAME
D6AZ-19562-BA	Silicone Rubber

OTHER APPLICABLE ARTICLES: None
WARRANTY STATUS: Eligible Under Basic Warranty Coverage

OPERATION	DESCRIPTION	TIME
902405A	Apply Silicone Rubber - Both Sides	0.4 Hr.

DEALER CODING

BASIC PART NO.
7041834

OASIS CODES: 105000, 702000

CONDITION CODE
56

Article No. 90-24-5 Cont'd.

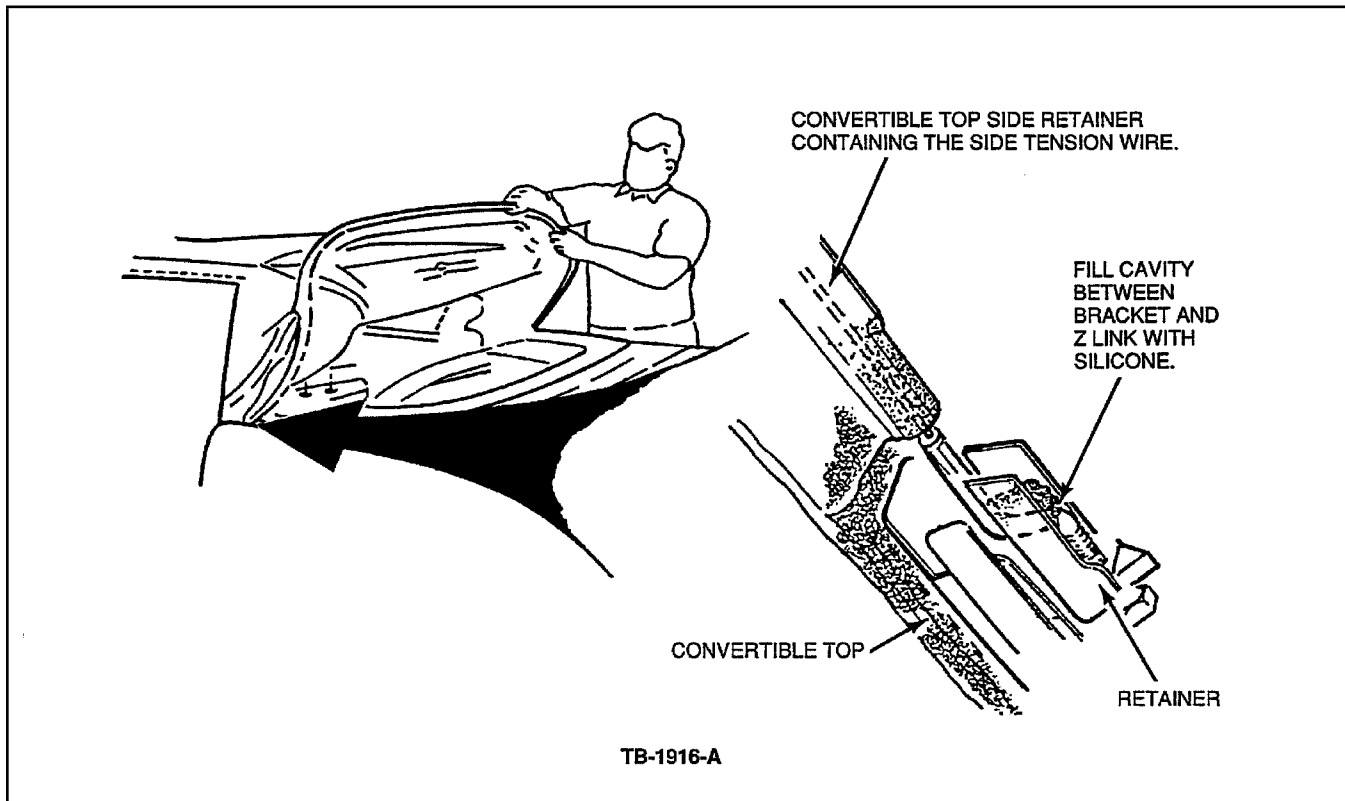


Figure 1 - Article 90-24-5